

20 August 1984

Dear Service Center,

There is a subtle, but very important, change to the 'Latest ROM Releases' and the 'Current Software and Firmware Releases' in this Update; a bold typeface is used to denote new items and italics to denote changes from the previous list. The highlighting of changes to the lists is a direct response to a request by a Service Center. We appreciate the suggestion and remind you that you may send your comments or suggestions for the Update to the Customer Service Update Editor.

There are several 'Hot' items this month. Pages 6 and 12 describe software upgrades available from Customer Service. Ordering information on the new Extended Limited Warranties and an addendum to the Customer Service Price List are two other items which should be of special interest to you.

In next month's issue there will be some tips on the Utility and Printer Server operation. A note here: When using the Printer Server from an OmniDrive, it is necessary to initialize Pipes and spool a file prior to turning on the Printer Server. If this is not done, the Printer Server may not find the pipes area.

Regards,

George Amarandos

Product Support Manager





# **CUSTOMER SERVICE UPDATE 4.8**

Letter from George Amarandos	
Latest ROM Releases	
Current Software and Firmware Releases	. 3
DEC Rainbow	
Apple II/IIe	. 7
Utility Server	. 8
IBM XT Mirror	. 9
Drive and Server Names and Passwords	.10
Concept Buffered Floppy Interface Cards	.11
Shugart Drives with IBM PCs and Zenith 150s	.12
New Extended Limited Warranty Available	.13
Customer Service Price List Addendum	





**UPDATE VOLUME 4.8** 

# LATEST ROM RELEASES

Note: Additions to the July 1984 list are in **bold face** type. Changes to the July 1984 list are in *italics*.

		Position	ROM Code Version	Firmware Version	Comments
CONTROLLER ROMS OmniDrive—	Boot PROM 6801 MCU	U4 U24	ODC100 T9B	FODR1.6	
OmniDrive— Macintosh	Boot PROM 6801 MCU Logic Array	U4 U24 U15	MOD120 T9B MCPAL1		
H-Series Drives		U62	C7.63	18.4AP	
6-MB Revision B Drives		U31 U32	C7.58 C8.58	18.4AP	
11/20-MB Revision B Drives		F2 H2	C3.22 C4.22	18.4AP	
The Bank		U105 U103	BKB280 T9.B	FBNK4.3	On Diagnostic diskette
OMNINET PERIPHERAL	s				
Disk Server	Boot PROM 6801 MCU	U3 U1	DS9B1D T9.B		For use with Bank and Multiple Servers
Disk Server	Boot PROM 6801 MCU	U3 U1	DS18.A 8A		For use with Bank
Disk Server	Boot PROM 6801 MCU	U3 U1	DS8A.A 8A		For use with H-Series drives w/o Bank
Utility Server	Boot PROM 6801 MCU	U27 U15	CRB120S T9.B		
TRANSPORTER ROMS					
Apple II	Boot PROM 6801 MCU	U15 U5	AT1.8 8A		For use with Const I
Apple II	Boot PROM 6801 MCU	U15 U5	<i>ATB310</i> T9.B		For use with Const II
Apple III	6801 MCU	U5	8A		
DEC Rainbow	EXT 6801 PROM 6801 MCU	u U16 U7	EXT9B 8A		
IBM PC/XT	Boot PROM 6801 MCU	U36 U9	ITB150S 8A		
TI Professional	Boot PROM 6801 MCU	U36 U9	TTB160 8A		
Zenith Z100	6801 MCU	U8	8A		

	Position	ROM Code Version	Firmware Version	Comments
INTERFACE ROMS				
Apple II/IIe IBM PC/XT Concept	U10 U12 U10	A4.7 IFB150S A4.7		
CONCEPT				
Boot PROMs	U706 U711	CCB0.7L CCB0.7H		Rev A Processor
	U706 U710	CCB1.7L CCB1.7H		Rev B Processor
Mapper PROM	U309	CM0.4A		
MISCELLANEOUS				
IBM XT Mirror Card	U24	MBC240		





**UPDATE VOLUME 4.8** 

# **CURRENT SOFTWARE AND FIRMWARE RELEASES**

Note: Additions to the July 1984 list are in **bold face** type. Changes to the July 1984 list are in *italics*.

Computer	Diskette Firmware Version	Softwa	are Date	Comments
Apple II/IIe Constellation II	FODR1.5 18.5	Pascal 1.1/1.2 Vol 1	30 Apr 84	Firmware versions given are the lowest acceptable version for use with that operating system
	FODR1.5 18.5	DOS 3.3 Vol 1 & 2	30 Apr 84	
	FODR1.6 18.6	CP/M Vol 1 & 3 Vol 2	30 Apr 84 25 Jun 84	
	FODR1.5 18.5	ProDOS Vol 1 & 2	14 Jun 84	
		Const Utils Vol 1 & 4 Vol 2 & 3	25 Jun 84 4 Jul 84	
		Printer Server Bank	11 Jun 84 20 May 84	
Apple II/IIe Constellation I	18.4AP	BASIC Pascal Vol 1 Pascal Vol 2 Pascal Diag CP/M CP/M2.2 Pascal 1.1 Constellation BASIC Pascal Remote Mirror Utility Server Disketteshare DOS Utilities	21 Nov 82 22 Dec 82 21 Nov 82 22 Dec 82 12 Jan 83 12 Jan 83 21 Nov 82 21 Nov 82 3 Dec 82 30 Sep 83	All Drives except OmniDrive
		Network Server	22 Aug 83 22 Aug 83	
Apple III	18.4AP	CORIII1 CORIII2 CORIII3	11 Mar 83 11 Mar 83 11 Mar 83	All Drives except OmniDrive
Atari 800	18.3	Vol 1 & 2	14 Jan 83	All Drives except OmniDrive

Computer	Diskette Firmware Version	Soft	Software Date		
Concept 8"	18.4AP	FBOOT FSYSGEN FDIAG FCCSYS1 FCCSYS2 FCCSYS3 FCCSYS4 FPSYS FPASCAL FFORTRN FLGICLC FEDWORD FCCLIB FISYS1 FISYS2 FGRAPH CP/M Emulator CP/M Master Printer Server Bank Volume 1 Bank Volume 2 'C' Compiler BASIC FPAINT	1 Feb 84 21 Mar 84 1 Feb 84 21 Mar 84 1 Feb 84 1 Feb 84 1 Feb 84 15 Feb 84 15 Feb 84 1 Feb 84 2 Jun 83 20 Jun 83 30 Sep 83 1 Feb 84 1 Feb 84 2 Jan 84 2 Jan 84 2 Jan 84 1 Dec 83	All Drives	
Concept 5.25"	18.4AP	FBOOT FCCSYS1 FCCSYS2 FPSYS FPASCAL FFORTRN FLGICLC FISYS FGRAPH FPAINT Bank 'C' Compiler BASIC	1 Feb 84 1 Feb 84 11 Dec 83 1 Feb 84 2 Jan 84	All Drives	
PEC LSI-11 (Flat-Cable Only)	CFLSI1.0	Vol 1 of 1	22 Aug 83		
DEC Robin	17.3	Vol 1 Vol 2	15 Nov 82 13 Apr 83	Revision B Drives	
PEC Robin	18.4	Vol 1 Vol 2	7 Dec 82 15 Nov 82	H-Series Drives	
EC Rainbow CP/M 86/80	FODR1.4	Vol 1 & 2 Vol 3	24 May 84 22 Jun 84	Omninet Only All Drives	
IS-DOS 2.0		Vol 1	20 Apr 84	Omninet Only All Drives	
MBCWT		Printer Server	2 Nov 84	2.1100	
MPC/XT DOS 2.X fultiple Server Release)	FODR1.4	Vol 1 & 2 Vol 3 <i>Vol 4</i>	23 Mar 84 27 Apr 84 17 Apr 84	All Drives	
BMPC/XT DOS 2.X	18.4AP	Vol 1, 2 & 5 Vol 3 Vol 4	2 Aug 83 14 Sep 83 6 Dec 83	All Drives except OmniDrive	
M PC/XT DOS 1.1	18.4AP	Vol 1 & 2 Vol 3 & 4	22 Jul 83 5 Aug 83	All Drives except OmniDrive	

Computer	Diskette Firmware Version	Softw	vare Date	Comments
IBM PC/XT		Printer Server XT Mirror Bank Diag Transfer Utils	27 Mar 84 20 Jan 84 10 Feb 84 10 Feb 84	DOS 1.1 or 2.X
IBM XT OmniShare		Vol 1 — 3	25 Jun 84	
NEC	17.3	Vol 1 Vol 2	15 Nov 82 1 Mar 82	Revision B Drives
NEC	18.4	Vol 1 Vol 2	7 Dec 82 15 Nov 82	H-Series Drives
Osborne	17.3	Vol 1 & 3 Vol 2 & 4	17 Jan 83 29 Jul 82	Revision B Drives
Osborne	18.4	Vol 1 & 3 Vol 2 & 4	11 Jan 83 15 Nov 83	H-Series Drives
S-100 CP/M2.2	17.3	Vol 1 Vol 2	30 Oct 82 13 Apr 82	Revision B Drives
S-100 CP/M 2.2	18.4	Vol 1 Vol 2	7 Dec 82 29 Oct 82	H-Series Drives
Sony	18.3	Vol 1 & 2 Mirror Utility	2 Nov 82 10 Jun 83	H-Series Drives
TIProfessional	FODR1.4 18.4AP	Vol 1, 2, & 2A Vol 3 Vol 4 Printer Server	26 Mar 84 27 Apr 84 17 Apr 84 24 Apr 84	All Drives
TRS-80 Model1	18.4	Vol 1 & 2 Vol 3	21 Jul 82 17 Jan 83	All Drives except OmniDrive
TRS-80 Model II	17.3	Vol 1 & 2	15 Nov 82	Revision B Drives
TRS-80 Model II	18.4	Vol 1 Vol 2	7 Dec 82 15 Nov 82	H-Series Drives
TRS-80 ModelIII	18.4	Vol 1 & 2 Vol 3	21 Jul 82 17 Jan 83	All Drives except OmniDrive
Xerox 820 5.25"	18.4	Vol 1 & 3 Vol 2 & 4	15 Nov 82 17 Feb 82	Revision B Drives
Xerox 820 8"	18.4	Vol 1 Vol 2	15 Nov 82 17 Feb 82	Revision B Drives
Xerox 820 5.25"	18.4	Vol 1-4	15 Nov 82	H-Series Drives
Xerox 820 8"	18.4	Vol 1 & 2	15 Nov 82	H-Series Drives
Zenith Z89	17.3	Vol 1 Vol 2-4	15 Nov 82 17 Feb 82	Revision B Drives
Zenith Z89	18.4	Vol 1 Vol 2-4	7 Dec 82 15 Nov 82	H-Series Drives
Zenith Z90	17.3	Vol 1 Vol 2	15 Nov 82 18 <b>M</b> ay 82	Revision B Drives
Zenith Z90	18.4	Vol 1 Vol 2	7 Dec 82 15 Nov 82	H-Series Drives
Zenith Z100 CP/M	18.4AP	Vol 1 & 4 Vol 2 & 2B Vol 3 Vol 5 & 6 Printer Server	5 Apr 84 22 Mar 84 30 Mar 84 20 Apr 84 2 May 84	Omninet Only All Drives





**UPDATE VOLUME 4.8** 

#### **DEC RAINBOW**

The 24 May 1984 release of utilities for the DEC Rainbow contains errors in two areas:

- 1) A problem has been discovered when using the Mirror program to restore an image. The program will continue to run and never return to indicate a successful restore.
- 2) The Omninet driver may occassionally report erroneous transmission failures. These will appear to the user as Omninet Errors 80, 82, or 83.

Both items have been corrected with the release of the Omninet driver. A single diskette is available from Customer Service at no charge. Specify Part Number 9000-00072-00 when ordering.

A separate item to note concerning the 24 May release of DEC Rainbow MS-DOS utilities: This release is intended for Omninet installation; although flat cable operation may work, it is not supported by Corvus.





**UPDATE VOLUME 4.8** 

#### APPLE II/IIe

When installing Constellation II on the Apple II/IIe, operating systems (i.e. DOS 3.3 or Pascal) are added after the drive has been "Sysgen-ed" for Constellation II use. If when installing an operating system the "Modify Existing Drive" option does not allow the addition of the four Apple operating systems (i.e. the options are not displayed), the Transporter card is probably not installed in slot 6 per the instructions in the *System Generation Guide*, or the floppy interface card is not in slot 4.

Make the appropriate slot corrections and re-boot as A2MGR to install the desired operating system.

If the message "Corvus Volume Table Not Found" appears, the problem may be a non-standard floppy controller or drive.

When using The Bank in conjunction with the Apple II under Constellation II, note that to format a tape the Transporter card must be in slot 7. Attempting to use any other slot will cause the Apple to jump into the machine language monitor when format is selected.





**UPDATE VOLUME 4.8** 

#### **UTILITY SERVER**

This month two issues will be addressed concerning the Utility Server. One involves difficulty installing the Printer Server software; the other, setting the time and date.

Numerous calls have been received from customers who are receiving Pascal "I/O Error #8" when attempting to install the Printer Server software. Failing to correctly create the PSERVER volume is normally the cause of this error. Instructions for creating the PSERVER volume can be found on page 6 of the *Utility Server Manager's Guide*; Constellation II Printer Server (7100-04910).

Failure to correctly mount the PSERVER volume will result in the error message "I/O Error #9" when attempting to "Update Utilities" from the Maintenance Manager. The error appears when the update program fails to find either the Printer Server distribution diskette in the first available floppy drive or the PSERVER volume is not on the required mount unit. Instructions are given in step 5 on page 9 of the above mentioned *Utility Server Manager's Guide*.

The correct unit to mount volume PSERVER on by computer type is:

Apple II/IIe	11
DEC Rainbow	9
IBM PC/XT	10
Texas Instruments Professional	10
Zenith Z100	10

As the PSERVER volume must be mounted on the unit specified above, the availability of that unit should be ascertained prior to mounting the volume. List the mounted volumes, and remount any volume currently mounted to the desired PSERVER unit.

Some users have reported difficulty in setting the time and date when using the Time Service portion of the Utility Server Manager software.

In most cases the difficulty was caused by the incorrect setting of a DIP switch within the Utility Server. Note that when position 8 of the DIP switch is "OFF" the time and date will be loaded from the disk drive at power-on. When position 8 is "ON" the time and date will be loaded from the internal clock chip.

It is recommended that once the time and date are loaded initially to the Utility Server, that position 8 be turned "ON" and that the server be left on to retain the current time and date.





**UPDATE VOLUME 4.8** 

## **IBM XT MIRROR**

Some users have reported that when attempting to back-up using the XT Mirror card for the first time the computer "hangs." The problem has been traced to the incorrect setting of jumper "E1" on the XT Mirror card. (The jumper is located on the lower portion of the card between ICs U19 and U20). This jumper should be installed either on position A or position B, but not both. A number of cards were shipped from Corvus with both positions jumpered. For proper operation these cards should be checked before use.





**UPDATE VOLUME 4.8** 

## **DRIVE AND SERVER NAMES AND PASSWORDS**

The April 1984 Service Update detailed a procedure to alter the names and passwords of both the disk server and disk drive. Following the use of the FIXIT program to modify drive or server names, or passwords, the users' attributes must be modified using Constellation II utilities to reflect the changes made.

It should be noted that with the release of multiple server software an additional step is now required to specify the "Home Server."





**UPDATE VOLUME 4.8** 

## **CONCEPT BUFFERED FLOPPY INTERFACE CARDS**

Several calls have been received from customers who have removed jumpers which are installed on the buffered floppy interface and subsequently could not use the interface card.

The correct jumper settings are as follows:

#### 5 1/4" Double Sided Drive

E1 — B & C

E3 — Jumpered

E5 — Jumpered

E7 — Jumpered

E10 - B & C

E11 -- B & C

### 8" Double Sided Drive

E1 - A & B


E2 — Jumpered

E5 — Jumpered

E6 — Jumpered

E10 - A & B



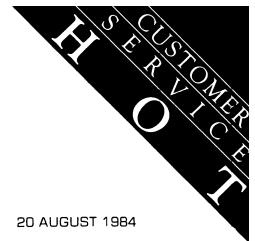

**UPDATE VOLUME 4.8** 

## SHUGART DRIVES WITH IBM PC'S AND ZENITH 150'S

IBM PC and Zenith 150 users with Shugart floppy disk drives have been unable to initialize their Corvus disk drives. This is the result of a slower step rate used by Shugart. To rectify this problem, a new set of CORMS diskettes has been released. These are CORMS21 and CORMS22, part number 9000-0070-00. This 3 August release is available through Customer Service as a no-charge upgrade to users who have previously purchased this Corvus software.





**UPDATE VOLUME 4.8** 

## **NEW EXTENDED LIMITED WARRANTY AVAILABLE**

A new Extended Limited Warranty package is available (United States only). All Corvus products may be covered, and at more attractive prices. Coverage may be purchased for a period of 6 or 24 months and is renewable; there is no longer a 30-month limitation on warranty coverage. Each Warranty Agreement can be tailored to the individual customer's needs which eliminates the need to stock product-specific warranties.

Further details on the new Extended Limited Warranty (Part Number 7100-06531-01) are available from Corvus Customer Service Administration at 408-559-5229.





**UPDATE VOLUME 4.8** 

## **CUSTOMER SERVICE PRICE LIST ADDENDUM**

The prices below are additions or changes to the "Corvus Customer Service Administration Manual Supplement," June 1984, Part Number 7100-06176-01. Price changes shall be effective 20 September 1984.

## **Customer Service Retail Price Schedule**

Description	Part Number	Retail	Dealer	Service	
H-Series Power Supply	8010-09322	235.00	188.00	164.55	C
SNA Gateway Parts					
A/C Panel	8010-08091	82.00	65.60	57.45	Α
Power Supply	8010-08522	355.00	284.00	248.50	Α
Memory Board	8010-08737	1645.00	1316.00	1151.50	Α
Controller	8010-10350	290.00	232.00	203.00	Α
Processor PCA	8010-10111	835.00	668.00	584.50	Α

# **Customer Service Exchange Price Schedule**

Description	<b>Part Number</b>	Retail	Dealer	Service	
Non-Etched Monitor	8010-08082	805.00	644.00	563.50	C
SNA Gateway Parts					
A/C Panel	8010-08091	60.00	48.00	42.00	Α
Power Supply	8010-08522	265.00	212.00	185.50	Α
Memory Board	8010-08737	1234.00	988.00	863.80	Α
Controller	8010-10350	215.00	172.00	150.50	Α
Processor PCA	8010-10111	630.00	504.00	441.00	Α

C — Price Change

A — New Item